

BOSCH**Diesel
Fuel Injection
Service**

INFORMATION

April 4, 1990
DSD SL 90-9

To: **Central Distributors and Diesel Service Dealers**

Subject: **Cracked Delivery Valves in A-2000 Injection Pumps used on Ford 6.6 Liter Engines**

Pump Combinations: 9 400 085 292
 9 400 085 297
 9 400 085 298

Some engines equipped with the above injection pumps may develop a "miss" due to cracked delivery valves (PN 9 401 083 462). When servicing injection pumps manufactured in the months 945 and 946, inspect all 6 delivery valves for their date of manufacture.

If the delivery valves are of 945 manufacture, they must be replaced with those of another manufacturing date.

Note: The manufacturing date can be found on the valve body. Do not confuse it with the manufacturing plant code "908" which is surrounded by an oval.

Standard warranty terms apply.

Sincerely,

Dick Lindberg
Product Support Manager, Heavy Duty
AUTOMOTIVE & DIESEL PRODUCTS

UA/ASV1-DL/51:dw

Robert Bosch Corporation
Sales Group • Department UA/ASV
2800 South 25th Avenue, Broadview, Illinois 60153