

INFORMATION

December 18, 1990
DSD SL 90-31

To: Central Distributors and Diesel Service Dealers

Subject: Delivery Valve Holder Breakage on Mack P-7100 Injection Pumps


Combination numbers:

0 402 746 836	0 402 746 866	0 402 746 874	0 402 748 801
0 402 746 837	0 402 746 870	0 402 746 875	0 402 748 802
0 402 746 838	0 402 746 871	0 402 746 876	0 402 748 803
0 402 746 852	0 402 746 872	0 402 746 885	
0 402 746 853	0 402 746 873	0 402 746 886	


Manufacturing Date:	Up to 071	Plant Code:	927
	Up to 064	Plant Code:	015

If, because of breakage, it becomes necessary to replace a delivery valve holder on the above pump combinations assembled with delivery valve holder, part number 2 413 371 197, you must replace all 6 with part number 2 413 371 204. These delivery valve holders require fill pieces, part number 2 410 120 019. The delivery valve springs remain the same. Be certain to replace the delivery valve gasket, part number 2 410 500 021.

To differentiate the two delivery valve holders there is an annular groove cut into part number 2 413 371 204 as illustrated below.

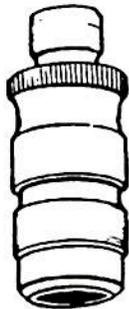


2 413 371 197

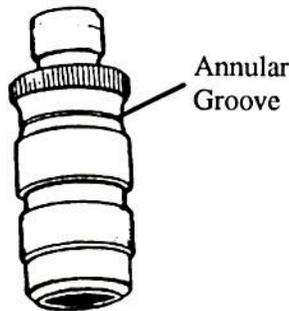

2 413 371 204

Standard warranty terms apply.

Sincerely,

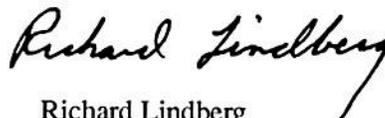

Richard Lindberg
Product Support Manager, Heavy-Duty
AUTOMOTIVE & DIESEL PRODUCTS

Robert Bosch Corporation
Sales Group • Department UA/ASV
2800 South 25th Avenue, Broadview, Illinois 60153